



# National Overhaul Warranty (NOW®) Engine Component Inspection Checklist

## Certificate Information

Certificate Number <u>61104</u>	Engine Model <u>ISX15</u>
Customer Name <u>Arenivar Trucking</u>	Control Module <u>CM2250</u>
Work Order Number <u>21546</u>	Rated Horsepower <u>550</u>
Date and Time <u>08/17/2022 11:00 am</u>	CPL Number <u>3606</u>
Engine Serial Number <u>79554061</u>	

## Instructions

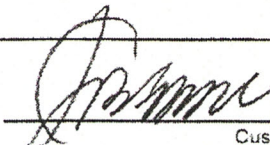
1. Ensure appropriate boxes are selected within the Inspected, Mandatory, and Optional Parts sections below.
2. All Inspected Parts must either pass inspection or be replaced.
3. All Mandatory Parts must be replaced.
4. Select the box for Optional Parts that were replaced at the time of the overhaul.

*Inspected Parts: The specified list of components must be inspected and if they meet the inspection guidelines, they will be warranted for the term of the coverage. Cummins expects the technician to make intelligent reuse decisions. The intent of the program is to do this by honest and thorough inspections with judgment that inspected parts will operate through the covered service period. If the defined parts do not pass inspection they must be replaced.*


Inspected Parts	Passed	Replaced
Cylinder Block	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Crankshaft	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Camshafts and Bushings	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Connecting Rod Assemblies	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Rocker Lever Assemblies	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Cylinder Head Cap Screws	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Lubricating Oil Pan & Suction Tube	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Intake Manifold	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Exhaust Manifold	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Push Tubes/Rods	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Piston Cooling Nozzles	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Valve Crossheads	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Cylinder Head (Midrange only)	<input type="checkbox"/>	<input checked="" type="checkbox"/>

Mandatory Parts	Replaced
Main Bearings	<input checked="" type="checkbox"/>
Connecting Rod Bearings	<input checked="" type="checkbox"/>
Pistons and Rings	<input checked="" type="checkbox"/>
Cylinder Liners (excludes B family)	<input checked="" type="checkbox"/>
Necessary Gaskets and Seals	<input checked="" type="checkbox"/>
Thermostat	<input checked="" type="checkbox"/>
Cylinder Head(s) (Heavy Duty only)	<input checked="" type="checkbox"/>
Lube Filter Bypass Assembly	<input checked="" type="checkbox"/>

Optional Parts	Replaced
Fuel Pump	<input checked="" type="checkbox"/>
Water Pump	<input checked="" type="checkbox"/>
Lube Oil Pump	<input checked="" type="checkbox"/>
Air Compressor	<input checked="" type="checkbox"/>
Starter	<input type="checkbox"/>
Alternator	<input type="checkbox"/>
Accessory Drive	<input type="checkbox"/>
Injectors	<input checked="" type="checkbox"/>
Complete Turbocharger	<input checked="" type="checkbox"/>
Vibration Damper	<input checked="" type="checkbox"/>
Short Block	<input type="checkbox"/>
Long Block	<input checked="" type="checkbox"/>

Pick-up Time 11:00 am Date 08/17/2022  Customer Signature

Certified Technician  8951319

Approved  Eric Rhodes  
Service Manager/Shop Foreman Warranty Administrator

For certificate registration and warranty administration purposes the NOW program will be registered and administered with a NOW certificate.



# National Overhaul Warranty (NOW®) Engine Certificate

## Customer & Service Location Information

 Used Vehicle Awaiting Sale

Customer Name Arenivar Trucking  
 Address 4761 W 1525 S  
 City Cedar City  
 State and Zip Utah 84720  
 Phone (435) 704-4851  
 Email arenivarjose@yahoo.com

Service Location St George Peterbilt  
 Address 203 Playa Della Rosita  
 City Washington  
 State and Zip Utah 84780  
 Phone (435) 216-7800  
 Service Location Code 31337

## Engine Information

Engine Serial Number 79554061  
 Engine Model ISX15  
 Control Module CM2250  
 Rated Horsepower 550  
 CPL Number 3606

VIN 1XPXD49X5DD162083  
 Odometer / Hour Meter 1179917 miles / 32724 hrs  
 Work Order Number 21546  
 Repair Date 08/17/2022  
 Equipment Application Automotive

## Inspected / Replaced

Cylinder Block  
 Crankshaft  
 Camshafts and Bushings  
 Connecting Rod Assemblies  
 Rocker Lever Assemblies  
 Cylinder Head Cap Screws  
 Lubricating Oil Pan & Suction Tube  
 Intake Manifold  
 Exhaust Manifold  
 Push Tubes/Rods  
 Piston Cooling Nozzles  
 Valve Crossheads  
 Cylinder Head (Midrange only)

## Mandatory Replaced

Main Bearings  
 Connecting Rod Bearings  
 Pistons and Rings  
 Cylinder Liners (excludes B family)  
 Necessary Gaskets and Seals  
 Thermostat  
 Cylinder Head(s) (Heavy Duty only)  
 Lube Filter Bypass Assembly

## Optional Replaced

Fuel Pump  
 Water Pump  
 Lube Oil Pump  
 Air Compressor  
 Starter  
 Alternator  
 Accessory Drive  
 Injectors  
 Complete Turbocharger  
 Vibration Damper  
 Short Block  
 Long Block

*Note: Optional components not replaced during the time of overhaul will not receive NOW coverage*

## Extended Warranty Coverage

- Midrange - 2 Years / 100,000mi (160,930km) / 3,600hrs  
 Midrange - 3 Years / 150,000mi (241,400km) / 5,400hrs  
 Heavy Duty - 2 Years / 200,000mi (321,870km) / 7,200hrs  
 Heavy Duty - 3 Years / 300,000mi (482,800km) / 10,800hrs (CM2350 Only, purchase ELITE Kit)

Promotion ID # 1056668  
 Promotion ID # B951379

Qualified Machinist Zack McPherson  
 Qualified Technician Ky Chynoweth

I hereby certify prior to the purchase of my overhaul, I received, read, understood and agreed to the terms of the Cummins and/or ReCon standard published warranty applicable to my engine. I also agree to the provision of the Plan as indicated above and detailed legal description on the back of this certificate.

Customer Signature

Customer must retain copies of the work order and component inspection checklist with NOW Certificate. Work order shall govern any discrepancies between the Certificate and work order.

Archer



CUSTOMER #: 137342  
UNIT# 9

21546

JACKSON GROUP PETERBILT  
- ST. GEORGE

203 E. Playa Della Rosita  
Washington, UT 84780  
(435) 216-7800  
Fax: (435) 216-7801

\*INVOICE\*

DUPLICATE 1  
PAGE 3

PARK WESTERN FINANCIAL CORP  
13949 W COLFAX STE 200  
GOLDEN, CO 80401

HOME: CONT:435-704-4851  
BUS: CELL:

SERVICE ADVISOR: 1724 Kyle Chamberlain

Jackson Group Lockbox  
Dept # 880555  
PO Box 29650  
Phoenix, AZ 85038-9650

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
	13	PETERBILT 389	1XPXD49X5DD162083		1179917/1179917	162083	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15MAR12	DD27FEB12		23:00 03AUG22		0.00	CASH	18AUG22
R.O. OPENED	READY	OPTIONS: DLR:P250 ENG:79554061					
18JUL22	18AUG22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
-1	2872661	RXCUM	CORE	RETURN	242.50	242.50	-242.50
-1	5594275	NXCUM	CORE	RETURN	12.50	12.50	-12.50
MISC	UPS	FRT	FROM	CALDWELL, AIR FILTER		85.00	85.00
MISC	NOW	OVERHAUL	61104	2 YEAR 200K MILES.		3450.00	3450.00
LUBE	QTY 46	105420EXX	ENGINE	OIL		195.96	195.96
LUBE	QTY 14	103124EXX	ELC	50/50		184.24	184.24
MISC	EMG	LV	PDC	TO	STG	280.00	280.00
MISC	UPSG	FRT	FOR	CUMMINS WATER PIPE/O-RING		15.00	15.00

1179917 FAILED LINER O RING, FAILED CRANKSHAFT. VERIFIED COMPLAINT OF COOLANT IN OIL. ATTEMPTED TO START TRUCK. TRUCK WOULD NOT START. ATTEMPTED TO JUMP START TRUCK. STILL WOULD NOT START. FOUND CORRODED BATTERY CONNECTIONS AND LOW BATTERY. CLEANED ALL BATTERY CONNECTIONS AND INSTALLED 2 MORE JUMPER WIRES FOR BATTERY PACK IN ORDER TO CONNECT ALL 4 BATTERIES. CHARGED BATTERIES. STARTED ENGINE AND RAN UP TO TEMP. PERFORMED COMBUSTION GAS TEST. PASSED TEST. NO COMBUSTION GASES IN COOLANT. REMOVED EGR COOLER OUTLET TUBE. PRESSURED UP COOLANT SYSTEM AND CHECKED EGR COOLER FOR LEAKS. NO LEAKS FOUND. DRAINED OIL AND REMOVED OIL PAN. REMOVED OIL PICKUP TUBE AND STIFFENER PLATE. FOUND COOLANT LEAKING FROM CYLINDER 4 LINER BETWEEN BLOCK AND LINER. DRAINED COOLANT, RECOVERED A/C AND REMOVED COOLING PACKAGE. REMOVED ALL NECESSARY COMPONENTS AND REMOVED CYLINDER HEAD. PERFORMED NOW INSPECTIONS ON ALL ITEMS. FOUND THAT CRANKSHAFT DOES NOT MEET REUSE. CUSTOMER OPTED FOR LONG BLOCK REPLACEMENT. REMOVED AND DISCONNECTED ALL NECESSARY COMPONENTS AND REMOVED TRANSMISSION. CONNECT BLOCK TO CRANE AND REMOVED BLOCK FROM ENGINE. CLEAN, INSPECT AND TRANSFER ALL ITEMS THAT MET REUSE TO NEW BLOCK USING NEW GASKETS AND HARDWARE WHERE REQUIRED. . SWAP SUMP ARRANGEMENT ON BLOCK. INSTALLED NEW TURBO AND AIR COMPRESSOR ON NEW BLOCK. PERFORM SHORT BLOCK HIGH PRESSURE FUEL PUMP

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER  
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

CUSTOMER #: 137342  
 UNIT# 9

21546

**Peterbilt** **JGP**  
 JACKSON GROUP PETERBILT  
 - ST. GEORGE

PARK WESTERN FINANCIAL CORP  
 13949 W COLFAX STE 200  
 GOLDEN, CO 80401

\*INVOICE\*

DUPLICATE 1  
 PAGE 2

203 E. Playa Della Rosita  
 Washington, UT 84780  
 (435) 216-7800  
 Fax: (435) 216-7801

HOME: CONT:435-704-4851  
 BUS: CELL:

Jackson Group Lockbox  
 Dept # 880555  
 PO Box 29650  
 Phoenix, AZ 85038-9650

SERVICE ADVISOR: 1724 Kyle Chamberlain

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
	13	PETERBILT 389	1XPXD49X5DD162083		1179917/1179917	162083	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15MAR12	DD27FEB12		23:00 03AUG22		0.00	CASH	18AUG22
R.O. OPENED	READY	OPTIONS: DLR:P250 ENG:79554061					
18JUL22	18AUG22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
2	3103015	CUM	SEAL,GROMMET		3.88	3.40	6.80
3	3683144	CUM	CLAMP,V BAND		63.37	55.48	166.44
3	3104230	CUM	GASKET,EXH GAS RCN VALVE		44.73	39.16	117.48
1	F37-6010	RECEIVER	DRIER W/ WAFER DYE		139.21	127.94	127.94
1	P555776	FILTER-FUEL	SPIN ON		85.04	60.98	60.98
1	P550851	FILTER-FUEL/WATER	SEPARATOR				
			CARTRIDGE		40.52	29.06	29.06
1	308925-20	CLUT EP 15.5,1860	TORQ,VCT DAMPR, 7-SPRNG		2092.25	1056.58	1056.58
1	K2468	KIT-CLUTCH	INSTALL		437.67	256.44	256.44
1	3678756	CUM	SEAL,O RING		10.49	9.18	9.18
1	2872661RX	CUM	HEAD,FUEL PUMP		2097.00	1837.41	1837.41
			CORE CHARGE C			242.50	242.50
2	4359134	CUM	TAPPET-PUMP		146.76	129.04	258.08
1	2872663	CUM	GASKET,FUEL PUMP		22.76	20.01	20.01
1	2872513	CUM	GASKET,FUEL PUMP		28.61	25.15	25.15
1	5264570	CUM	GASKET,OIL DRAIN		3.92	3.67	3.67
1	3695041	CUM	GASKET,TURBOCHARGER		15.69	13.79	13.79
1	3684338	CUM	GASKET,CONNECTION		27.86	24.50	24.50
1	4059172	CUM	SEAL,O RING		8.56	7.49	7.49
1	3949781	CUM	SEAL,O RING		6.83	5.98	5.98
1	3957131	CUM	SEAL,O RING		2.16	1.90	1.90
1	3678925	CUM	SEAL,O RING		7.29	6.38	6.38
1	5594275NX	CUM	SENSOR, POSITION		36.35	31.85	31.85
			CORE CHARGE C			12.50	12.50
1	3086030	CONNECTION,WATER	OUTLET		274.13	207.65	207.65
1	3081695	SEAL,O RING			5.11	4.14	4.14
1	V50-6027-01525	HOSE-LUBE	LINE 1/8-27 (PREPAID SPECIAL ORDER PART)		71.92	52.88	52.88
-1	DR7005RX	CUM	CORE RETURN		6875.00	6875.00	-6875.00
-1	5458503RX	CUM	CORE RETURN		875.00	875.00	-875.00
-1	4034289RX	CUM	CORE RETURN		250.00	250.00	-250.00
-1	3690864RX	CUM	CORE RETURN		125.00	125.00	-125.00
-1	2872658PX	CUM	CORE RETURN		150.00	150.00	-150.00

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER  
 The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
<b>PLEASE PAY THIS AMOUNT</b>	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

CUSTOMER #: 137342  
UNIT# 9

21546

  
JACKSON GROUP PETERBILT  
- ST. GEORGE

\*INVOICE\*

203 E. Playa Della Rosita  
Washington, UT 84780  
(435) 216-7800  
Fax: (435) 216-7801

DUPLICATE 1  
PAGE 1

Jackson Group Lockbox  
Dept # 880555  
PO Box 29650  
Phoenix, AZ 85038-9650

PARK WESTERN FINANCIAL CORP  
13949 W COLFAX STE 200  
GOLDEN, CO 80401

HOME: CONT:435-704-4851  
BUS: CELL:

SERVICE ADVISOR: 1724 Kyle Chamberlain

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
	13	PETERBILT 389	1XPXD49X5DD162083		1179917/1179917	162083	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15MAR12	DD27FEB12		23:00	03AUG22	0.00	CASH	18AUG22
R.O. OPENED	READY	OPTIONS: DLR:P250 ENG:79554061					
18JUL22	18AUG22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A INTERNAL COOLANT LOSS \*\*\*CK&ADVISE\*\*

CAUSE: LEAKING LINER

ENG ENGINE REPAIRS - JGP

1601 CUST 24.25  
2547 CUST 12.63  
2665 CUST 2.56  
3506 CUST 8.81  
773 CUST 1.75  
50.00

1 DR7005RXCUM ENGINE-ISX 15 LONG BLOCK	34931.33	7750.00	7750.00
CORE CHARGE C		6875.00	6875.00
1 EC50PLS CLAMP-EXHAUST WB PREFRMD 5" SS	13.15	13.15	13.15
1 5458503RXCUM KIT, TURBOCHARGER	7139.88	6256.05	6256.05
CORE CHARGE C		875.00	875.00
1 4034289RXCUM KIT, VG TUR ACT SERVICE	1692.15	1482.69	1482.69
CORE CHARGE C		250.00	250.00
1 3690864RXCUM COMPRESSOR, 1 CYL AIR	1839.42	1611.73	1611.73
CORE CHARGE C		125.00	125.00
1 2872658PXCUM PUMP-FUEL	2048.02	1794.50	1794.50
CORE CHARGE C		150.00	150.00
1 4988280CUM GASKET, HYDRAULIC PUMP	4.53	3.99	3.99
1 5440813CUM GASKET, ACC DRIVE SUPPORT	17.76	15.62	15.62
1 P550867 FILTER-COOLANT SPIN-ON NON CHEMICAL	56.62	40.60	40.60
2 3683814CUM SEAL, O RING	3.04	2.67	5.34
2 3683814CUM SEAL, O RING	3.04	2.67	5.34
1 3683607CUM SEALANT	5.10	4.49	4.49
4 5486657CUM GASKET, EXHAUST MANIFOLD	19.89	17.49	69.96
1 3682940CUM GASKET, EXHAUST MANIFOLD	21.77	19.06	19.06
1 4966441CUM GASKET, EXH OUT CONNECTION	20.96	18.34	18.34
4 4298242CUM STUD	18.28	17.02	68.08
4 4298975CUM NUT, LOCK	10.11	8.89	35.56
1 3684338CUM GASKET, CONNECTION	27.86	24.50	24.50
1 3688347CUM GASKET, INTAKE MANIFOLD	65.10	57.24	57.24
2 3102109CUM SEAL, O RING	5.35	4.69	9.38

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER  
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
<b>PLEASE PAY THIS AMOUNT</b>	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE



JACKSON GROUP PETERBILT  
- ST. GEORGE

203 E. Playa Della Rosita  
Washington, UT 84780  
(435) 216-7800  
Fax: (435) 216-7801

Jackson Group Lockbox  
Dept # 880555  
PO Box 29650  
Phoenix, AZ 85038-9650

CUSTOMER #: 137342  
UNIT# 9

21546

\*INVOICE\*

DUPLICATE 1  
PAGE 4

PARK WESTERN FINANCIAL CORP  
13949 W COLFAX STE 200  
GOLDEN, CO 80401

HOME: CONT: 435-704-4851  
BUS: CELL:

SERVICE ADVISOR: 1724 Kyle Chamberlain

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
	13	PETERBILT 389	1XPXD49X5DD162083		1179917/1179917	162083	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
15MAR12	DD27FEB12		23:00 03AUG22		0.00	CASH	18AUG22
R.O. OPENED	READY	OPTIONS: DLR:P250 ENG:79554061					
18JUL22	18AUG22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

REBUILD AND INSTALLED BLOCK. INSTALLED NEW OIL AND FUEL FILTERS ON BLOCK. MACHINED FLYWHEEL AND INSTALL ON BLOCK. INSTALL NEW PILOT BEARING. PERFORMED CLUTCH INSTALL KIT REPLACEMENT. INSTALLED NEW CLUTCH. REINSTALLED ALL REMOVED COMPONENTS IN REVERSE ORDER. INSTALL AND CALIBRATE NEW VGT ACTUATOR. EVAC AND RECHARGE A/C. FILL WITH NEW COOLANT AND ENGINE OIL. CHANGE PRIMARY FUEL FILTER AND AIR FILTERS. PRIME FUEL AND OIL. INSTALL NEW TRIM FILES USING INSITE. ADJUST CLUTCH AND LINKAGE. RUN ENGINE AND CHECK FOR LEAKS. STEAM CLEAN ENGINE AND PERFORMED ROAD TEST. NO ISSUES FOUND. PAINT ENGINE. REPAIR COMPLETE.

\*\*\*\*\*

B Moved to: 21546S Line: A

9996 Moved to: 21546S Line: A

1707 C 0.00

0.00 0.00

\*\*\*\*\*

\*\*\* THE FOLLOWING WORK NOT DONE-TRANSFERRED TO RO#21546S \*\*\*

B Moved to: 21546S Line: A

\*\*\*\*\*  
ESTIMATE: 0.00 03AUG22 09:06 SA: 1724

CONTACT:

\*\*\*\*\*

\*\*\*\*\*  
ESTIMATE: 0.00 18JUL22 08:37 SA: 1724

CONTACT:

\*\*\*\*\*

INTERNAL COOLANT LOSS

\*\*\*CK&ADVISE\*\*

PETERBILT "TRUCKCARE"

(800) 473-8372

24 HOUR EMERGENCY ROADSIDE SERVICE

WWW.PETERBILT.COM

DESCRIPTION	TOTALS
LABOR AMOUNT	7750.00
PARTS AMOUNT	48943.01
GAS, OIL, LUBE	380.20
SUBLET AMOUNT	0.00
MISC. CHARGES	4080.00
TOTAL CHARGES	61153.21
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	61153.21

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER  
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE